# Bi weekly Field Report

Surveyor Date visited


Time visited

Zaw La 25 Jul 2019 10:30 am

Weather Condition <u>Cloudy</u>
The last time of heavy raining: <u>Yesterday</u>

No	Item	Condition	Narrative Description and Photos	
1	(1.1) Water Supply System	Improved □ Same ■* Worse □ *as last week	Narrative Description  Water distribution system has been supporting ninety household of the zone B resettled families. The new well was drilled and installed the pipe line and its necessary instruments because the underground water of the previous well includes iron hydroxide and yellowish mud that clogged in the iron removal tank. The current water condition is quite good and no iron hydroxide and yellowish mud are found.	
			Photos	
			Water from ground water tank	Pipe line distribution water to houses
			THE HOLL STORING WALL WILL	Type file distribution water to houses

No	Item	Condition	Narrative Description and Photos		
1	(1.2) Well	Improved□ Same ■* Worse □ *as last week	<ul> <li>Water from two open-wells is clean enough to use for drinking and living. There are eleven tube wells in the relocation site. Residents use the water basically from the pipeline distribution system so that the frequency of water usage from the tube wells is very low. To sustain the good condition of the tube wells, the leg pumps were kept and covered the PVC pipes with the caps till the residents use.</li> </ul>		
	(a)		Open Well No. 1	Open Well No. 2	
	(2) Drainage	Improved□ Same ■* Worse □ *as last week	There is a little amount of water in Photos  The drain at the corner of Main Road A and B	The exit of the drain at the corner of Site village road and 2 <sup>nd</sup> street	
			The exit of the drain at the corner of Site village road and 3 <sup>rd</sup> street	The exit of the drain at the corner of Site village road and Main Road C	
	(3) Road	Improved□ Same ■* Worse □ *as last week	<ul> <li>All the roads except 6<sup>th</sup> street are still dry and no problem for walking. 6<sup>th</sup> street is being damaged due to passing the heavy trucks that carry the soil to fill near the creek side. Therefore the exits of the drain at the 6<sup>th</sup> street are being blocked with the soil.</li> </ul>		
			<u>Photos</u>		

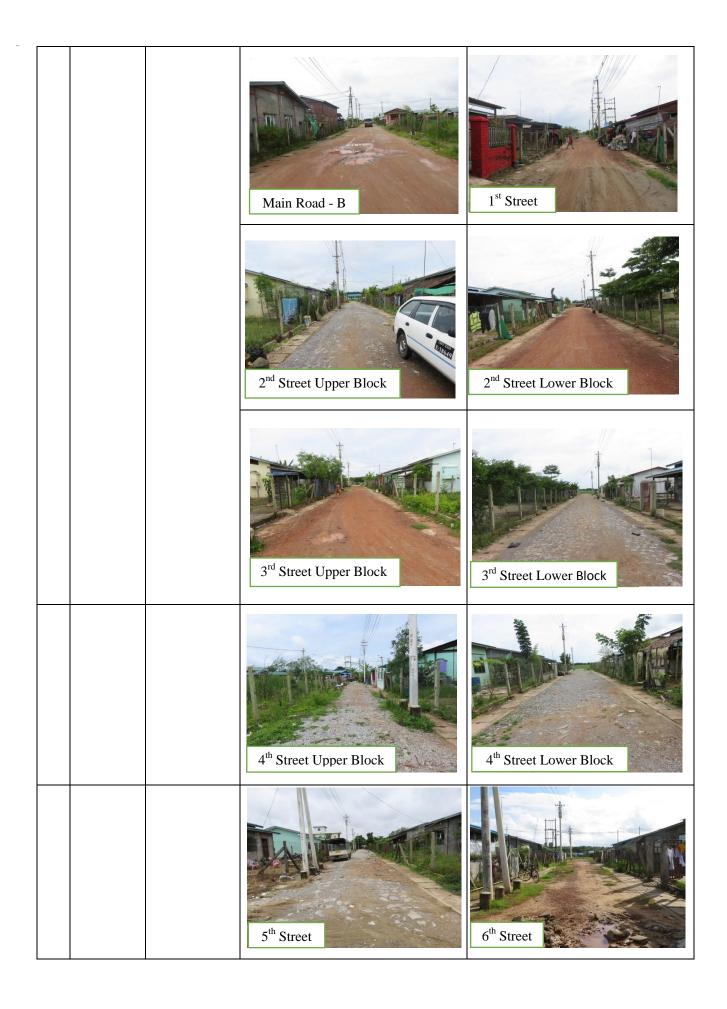

	Improved□	7 <sup>th</sup> Street	Site Village
(4) Garbage Condition	Same ■* Worse □ *as last week	of each road until the end of Apri are kept by the community leader near the triangle junction of Main	been provided. been provided and placed at the corner l. After April 2018, all the garbage bins of PAPs in the communal compound a Road C and Upper Fourth Street. But the truck from township municipal office
		Rubbishes in the creek near 1st street	Rubbishes in the creek near 2nd street
		The soil was filled near the creek of Main Road C in March	The soil was filled near the creek of 6 <sup>th</sup> Street in March

(5) Fly	
proof	
toilet	

Improved□
Same •\*
Worse □
\*as last week

- All of the fly proof toilets are used the residents.
- All of the toilets are repaired by the following procedures;
  - Installation the extra septic tanks beside the original
  - The pipe line system is installed from the extra tank to the ditch to flow the liquid out.

The toilet renovation plan was successfully done and there is no problem at the moment.

	No. of HHs					
Condition	This week condition	Previous				
		week condition				
Level 1	91	91				
Level 2	0	0				
Level 3	0	0				
Level 4	0	0				
No Toilet	0	0				

#### <Evaluation Criteria>

### Level 1

- Fly proof toilet is not needed to be repaired.
- No/rarely toilet unavailable

#### Level 2

- Fly proof toilet is needed to be repaired.
- Rarely toilet unavailable


#### Level 3

- Fly proof toilet is needed to be repaired.
- Often toilet unavailable
- As the result of filling the soil and also due to the heavy rain, some toilets are inconvenience to use.

### Level 4

- Fly proof toilet is urgently needed to be repaired.
- Often toilet unavailable

#### **Photos**

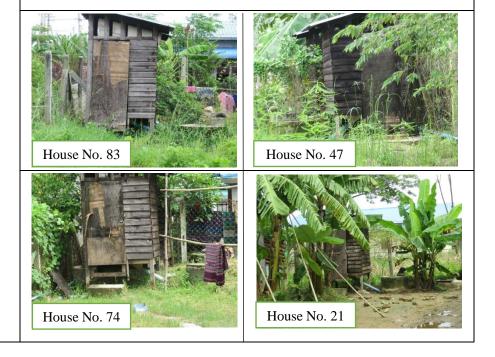

	(6) Electricity	Improved□ Same •* Worse □ *as last week	<ul> <li>Residents get the electricity regularly.</li> <li>Electric poles and transformer are being supported with the good foundations.</li> <li>There are some pieces of wood under an electric pole of main road B and it's needed to clean up.</li> </ul> Photos		
			Transformer No. 1	Transformer No. 2	
			Transformer No. 3	Electric poles of Main Road B and Main Road C	
	T.	G 11	Description and Photos		
No	Item	Condition	Description	and Photos	
2	(1)House Construction	No. of houses which are not completed (4)	<ul> <li>In plot No.9 and 10, three houses are owned by father and son. The are needed to be carried on.</li> </ul>	that are planned to build as the plots e second floors of these three houses on for the first floor has been finished	
	(1)House Construct-	No. of houses which are not	<ul> <li>In plot No.9 and 10, three houses are owned by father and son. The are needed to be carried on.</li> <li>Plot No. 66, the house construction</li> </ul>	that are planned to build as the plots e second floors of these three houses on for the first floor has been finished	
	(1)House Construct-	No. of houses which are not	<ul> <li>In plot No.9 and 10, three houses are owned by father and son. The are needed to be carried on.</li> <li>Plot No. 66, the house construction and the second floor is still needed.</li> </ul>	that are planned to build as the plots e second floors of these three houses on for the first floor has been finished	

3	Other Issues					
	(1). Drainage condition for	<u>Description</u>				
	rain water in the compounds					
			No. of HHs			
		Condition	This week	Previou		
		T 1.1	condition	condition	on	
		Level 1	82	82		
		Level 2	5	5		
		Level 3	3	3		
		Level 4	1	1		
		<evaluation 1<="" c="" level="" th=""><th>Criteria&gt;</th><th></th><th></th><th></th></evaluation>	Criteria>			
			o standing water	with their	· own drain	age system in their
		compound	standing water	with then	Own urani	age system in their
		Level 2	s standing water	in thair a	omnound	
		-No mud and no Level 3	standing water	in their co	Jiipoulia	
		- Some or little	mud and standir	no water ir	their com	nound
		Level 4	mua ana stanan	ng water n	i tileli com	pound
		-A lot of mud a	nd standing wate	er in their	compound	
						muddy again as it has
		been renovated with concrete. Therefore the other photo for level 3 will be changed in the next report.				
		Photos				
		Level 1  House No. 3			Level 2  House No	p. 19
		Level 3 House No. 64			Level 4  House No.	p. 84
		Level 3  House No. 7	5		Level 4  House No	. 88

### (2) Plantation

In front of the compounds, the shady trees, fruit trees, flowering plants and vegetables are being planted.

### Description

- In front of the compounds, the shade trees, fruit trees, flowering plants and vegetables are being planted.

Type	No. of	Remarks
	HHs	
Shade tree	15	Albizzia, Indian almond, Neem tree, etc. HH No. 20, 40, 43, 48, 51, 57, 59, 61, 62, 67, 69, 72, 73, 77, 85
Fruit tree	37	Banana, Mango, sugar cane, coconut, citrus and jack fruit etc.  HH No. 3, 15, 17, 20,21, 23, 28, 30, 31, 32, 34, 37, 40, 41, 48, 51, 52, 55, 57, 58, 59, 61, 62, 63, 67, 68, 70, 71, 72, 73, 77, 78, 82, 85, 86, 88
Vegetables	20	Chili, tomato, bitter gourd, Roselle, gourd, basils, eggplant etc. HH No. 12, 17, 21, 41, 49, 58, 59, 61, 62, 63, 67, 68, 70, 71, 72, 73, 77, 82, 85, 86
Flowering plant	31	Jasmine, poinsettia, orchid, kiss me quick, etc. HH No. 3, 5, 6, 8, 10, 12, 13, 14, 17, 20, 21, 22, 23, 29, 30, 31, 32, 46, 48, 58, 59, 61, 62, 65, 67, 68, 69, 72, 77, 78, 86

### Photos.









### (3) Livestock

## **Description**

-The chicken, gooses and ducks are being raised.

Type	No. of HHs	Remarks
Chicken	6	HH No. 13, 14, 21,
		59, 67, 78
Duck	3	HH No.12
Goose	2	HH No. 40, 67

# **Photos**



