





















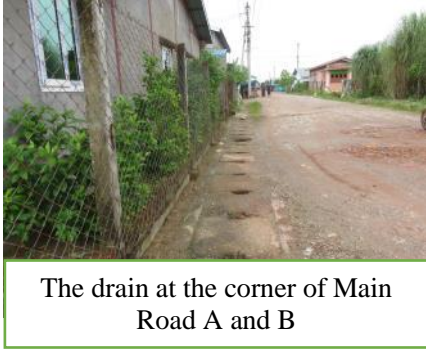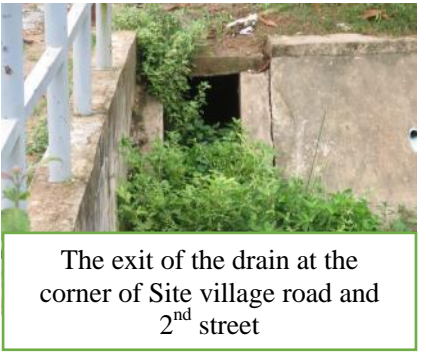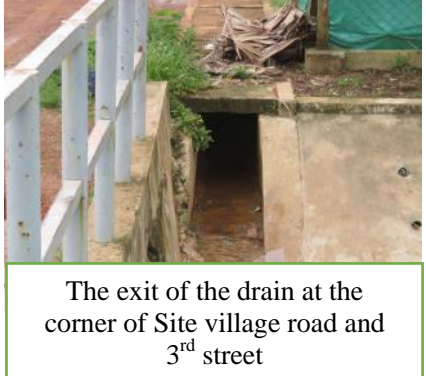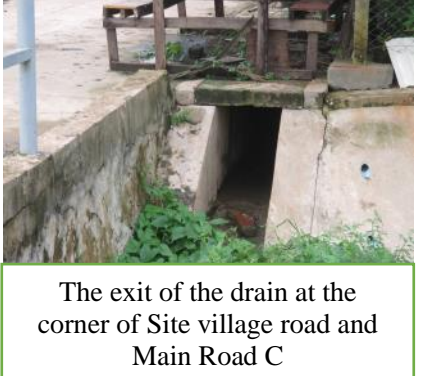

Surveyor Zaw La  
 Date visited 29 Jul 2020  
 Time visited 15:00 pm







Weather Condition Cloudy  
 The last time of heavy raining:

No	Item	Condition	Narrative Description and Photos
1	(1.1) Water Supply System	Improved <input type="checkbox"/> Same <input checked="" type="checkbox"/> * Worse <input type="checkbox"/> *as last week	<p><b><u>Narrative Description</u></b></p> <p>Water distribution system has been supporting ninety household of the zone B resettled families. The new well was drilled and installed the pipe line and its necessary instruments because the underground water of the previous well includes iron hydroxide and yellowish mud that clogged in the iron removal tank. The current water condition is quite good and no iron hydroxide and yellowish mud are found.</p> <p><b><u>Photos</u></b></p> <div style="display: flex; flex-wrap: wrap;"> <div style="width: 50%; text-align: center;">  </div> <div style="width: 50%; text-align: center;">  </div> <div style="width: 50%; text-align: center;">  <p>Water from ground water tank</p> </div> <div style="width: 50%; text-align: center;">  <p>Pipe line distribution water to houses</p> </div> <div style="width: 50%; text-align: center;">  </div> <div style="width: 50%; text-align: center;">  </div> </div>

No	Item	Condition	Narrative Description and Photos
1	(1.2) Well	Improved <input type="checkbox"/> Same <input checked="" type="checkbox"/> * Worse <input type="checkbox"/> <i>*as last week</i>	<p>– Water from two open-wells is clean enough to use for drinking and living. There are eleven tube wells in the relocation site. Residents use the water basically from the pipeline distribution system so that the frequency of water usage from the tube wells is very low. To sustain the good condition of the tube wells, the leg pumps were kept and covered the PVC pipes with the caps till the residents use.</p>
			<div style="display: flex; justify-content: space-around;"> <div style="text-align: center;">  <p>Open Well No. 1</p> </div> <div style="text-align: center;">  <p>Open Well No. 2</p> </div> </div>
	(2) Drainage	Improved <input type="checkbox"/> Same <input checked="" type="checkbox"/> * Worse <input type="checkbox"/> <i>*as last week</i>	<p>– There is no water in the drainage canals at the moment.</p> <p><b>Photos</b></p> <div style="display: grid; grid-template-columns: 1fr 1fr; gap: 5px;"> <div style="text-align: center;">  <p>The drain at the corner of Main Road A and B</p> </div> <div style="text-align: center;">  <p>The exit of the drain at the corner of Site village road and 2<sup>nd</sup> street</p> </div> <div style="text-align: center;">  <p>The exit of the drain at the corner of Site village road and 3<sup>rd</sup> street</p> </div> <div style="text-align: center;">  <p>The exit of the drain at the corner of Site village road and Main Road C</p> </div> </div>
	(3) Road	Improved <input type="checkbox"/> Same <input checked="" type="checkbox"/> * Worse <input type="checkbox"/> <i>*as last week</i>	<p>– Some roads are found with small ponds due to the rain in these days but no problem for walking.</p> <p><b>Photos</b></p>

			 <p>Main Road - B</p>	 <p>1<sup>st</sup> Street</p>
			 <p>2<sup>nd</sup> Street Upper Block</p>	 <p>2<sup>nd</sup> Street Lower Block</p>
			 <p>3<sup>rd</sup> Street Upper Block</p>	 <p>3<sup>rd</sup> Street Lower Block</p>
			 <p>4<sup>th</sup> Street Upper Block</p>	 <p>4<sup>th</sup> Street Lower Block</p>
			 <p>5<sup>th</sup> Street</p>	 <p>6<sup>th</sup> Street</p>



			 <p>7<sup>th</sup> Street</p>	 <p>Site Village Road</p>
(4) Garbage Condition	Improved <input type="checkbox"/> Same <input checked="" type="checkbox"/> * Worse <input type="checkbox"/> <i>*as last week</i>	<ul style="list-style-type: none"> <li>- The rubbish was dumped at the creek side and even in front of the houses before the enough garbage bins are provided.</li> <li>- Total fourteen garbage bins have been provided and placed at the corner of each road until the end of April. After April 2018, all the garbage bins are kept by the community leader of PAPs in the communal compound of well number one of main road B. But starting from October, the garbage truck from township municipal office came and collected by giving its alarm along the Main Road B.</li> </ul> <p><b>Photos</b></p>	 <p>Rubbishes in the creek near 1st street</p>	 <p>Rubbishes in the creek near 2nd street</p>
			 <p>The soil was filled near the creek of Main Road C in March</p>	 <p>The soil was filled near the creek of 6<sup>th</sup> Street in March</p>

(5) Fly proof toilet

Improved   
 Same \*  
 Worse   
 \*as last week

- All of the fly proof toilets are used by the residents.
- All of the toilets are repaired by the following procedures;
  - Installation the extra septic tanks beside the original
  - The pipe line system is installed from the extra tank to the ditch to flow the liquid out.

The toilet renovation plan was successfully done and there is no problem at the moment.

Condition	No. of HHs	
	This week condition	Previous week condition
Level 1	91	91
Level 2	0	0
Level 3	0	0
Level 4	0	0
No Toilet	0	0

**<Evaluation Criteria>**

**Level 1**

- Fly proof toilet is not needed to be repaired.
- No/rarely toilet unavailable

**Level 2**

- Fly proof toilet is needed to be repaired.
- Rarely toilet unavailable

**Level 3**

- Fly proof toilet is needed to be repaired.
- Often toilet unavailable
- As the result of filling the soil and also due to the heavy rain, some toilets are inconvenience to use.

**Level 4**

- Fly proof toilet is urgently needed to be repaired.
- Often toilet unavailable

**Photos**



House No. 46







House No. 50






House No. 80













House No. 87

(6) Electricity	Improved <input type="checkbox"/> Same <input checked="" type="checkbox"/> * Worse <input type="checkbox"/> <i>*as last week</i>	<ul style="list-style-type: none"> <li>- Residents get the electricity regularly.</li> <li>- Electric poles and transformer are being supported with the good foundations.</li> </ul> <p><b>Photos</b></p>		
		 <p>Transformer No. 1</p>	 <p>Transformer No. 2</p>	
		 <p>Transformer No. 3</p>	 <p>Electric poles of Main Road B and Main Road C</p>	

No	Item	Condition	Description and Photos	
2	(1)House Construction	No. of houses which are not completed (4)	<ul style="list-style-type: none"> <li>- In plot No.9 and 10, three houses that are planned to build as the plots are owned by father and son. The second floors of these three houses are needed to be carried on.</li> <li>- Plot No. 66, the house construction for the first floor has been finished and the second floor is still needed to be carried on.</li> </ul> <p><b>Photos</b></p>	
			 <p>House No. 9</p>	 <p>House No. 10</p>
			 <p>House No. 66</p>	



3	Other Issues																		
	(1). Drainage condition for rain water in the compounds	<p data-bbox="568 138 702 170"><u>Description</u></p> <table border="1" data-bbox="568 197 1155 430"> <thead> <tr> <th data-bbox="568 197 753 295" rowspan="2">Condition</th> <th colspan="2" data-bbox="759 197 1155 228">No. of HHs</th> </tr> <tr> <th data-bbox="759 228 938 295">This week condition</th> <th data-bbox="944 228 1155 295">Previous week condition</th> </tr> </thead> <tbody> <tr> <td data-bbox="568 295 753 327">Level 1</td> <td data-bbox="759 295 938 327">87</td> <td data-bbox="944 295 1155 327">87</td> </tr> <tr> <td data-bbox="568 327 753 358">Level 2</td> <td data-bbox="759 327 938 358">2</td> <td data-bbox="944 327 1155 358">2</td> </tr> <tr> <td data-bbox="568 358 753 389">Level 3</td> <td data-bbox="759 358 938 389">2</td> <td data-bbox="944 358 1155 389">2</td> </tr> <tr> <td data-bbox="568 389 753 421">Level 4</td> <td data-bbox="759 389 938 421"></td> <td data-bbox="944 389 1155 421"></td> </tr> </tbody> </table> <p data-bbox="568 465 845 497">&lt;Evaluation Criteria&gt;</p> <p data-bbox="568 497 654 528"><b>Level 1</b></p> <p data-bbox="568 528 1372 591">-No mud and no standing water with their own drainage system in their compound</p> <p data-bbox="568 591 654 622"><b>Level 2</b></p> <p data-bbox="568 622 1139 654">-No mud and no standing water in their compound</p> <p data-bbox="568 654 660 685"><b>Level 3</b></p> <p data-bbox="568 685 1228 716">- Some or little mud and standing water in their compound</p> <p data-bbox="568 716 654 748"><b>Level 4</b></p> <p data-bbox="568 748 1155 779">-A lot of mud and standing water in their compound</p> <p data-bbox="568 846 654 878"><u>Photos</u></p> <div data-bbox="574 940 1002 1254"> <p data-bbox="580 949 708 981">Level 1</p>  <p data-bbox="580 1209 766 1240">House No.31</p> </div> <div data-bbox="1021 940 1449 1254"> <p data-bbox="1027 949 1155 981">Level 2</p>  <p data-bbox="1027 1209 1212 1240">House No.19</p> </div> <div data-bbox="574 1263 1002 1576"> <p data-bbox="580 1272 708 1303">Level 3</p>  <p data-bbox="580 1532 766 1563">House No. 64</p> </div> <div data-bbox="1021 1263 1449 1576"> <p data-bbox="1027 1272 1155 1303">Level 4</p>  <p data-bbox="1027 1532 1212 1563">House No. 84</p> </div> <div data-bbox="574 1621 1002 1935"> <p data-bbox="580 1630 708 1662">Level 3</p>  <p data-bbox="580 1890 766 1921">House No. 75</p> </div> <div data-bbox="1021 1621 1449 1935"> <p data-bbox="1027 1630 1155 1662">Level 4</p>  <p data-bbox="1027 1890 1212 1921">House No. 88</p> </div>	Condition	No. of HHs		This week condition	Previous week condition	Level 1	87	87	Level 2	2	2	Level 3	2	2	Level 4		
Condition	No. of HHs																		
	This week condition	Previous week condition																	
Level 1	87	87																	
Level 2	2	2																	
Level 3	2	2																	
Level 4																			

<p>(2) Plantation</p>	<p>- In front of the compounds, the shady trees, fruit trees, flowering plants and vegetables are being planted.</p> <p><u>Description</u></p> <p>- In front of the compounds, the shade trees, fruit trees, flowering plants and vegetables are being planted.</p> <table border="1" data-bbox="571 331 1439 943"> <thead> <tr> <th>Type</th> <th>No. of HHs</th> <th>Remarks</th> </tr> </thead> <tbody> <tr> <td>Shade tree</td> <td>15</td> <td>Albizia, Indian almond, Neem tree, etc. HH No. 20, 40, 43, 48, 51, 57, 59, 61, 62, 67, 69, 72, 73, 77, 85</td> </tr> <tr> <td>Fruit tree</td> <td>37</td> <td>Banana, Mango, sugar cane, coconut, citrus and jack fruit etc. HH No. 3, 15, 17, 20,21, 23, 28, 30, 31, 32, 34, 37, 40, 41, 48, 51, 52, 55, 57, 58, 59, 61, 62, 63, 67, 68, 70, 71, 72, 73, 77, 78, 82, 85, 86, 88</td> </tr> <tr> <td>Vegetables</td> <td>20</td> <td>Chili, tomato, bitter gourd, Roselle, gourd, basils, eggplant etc. HH No. 12, 17, 21, 41, 49, 58, 59, 61, 62, 63, 67, 68, 70, 71, 72, 73, 77, 82, 85, 86</td> </tr> <tr> <td>Flowering plant</td> <td>31</td> <td>Jasmine, poinsettia, orchid, kiss me quick, etc. HH No. 3, 5, 6, 8, 10, 12, 13, 14, 17, 20, 21, 22, 23, 29, 30, 31, 32, 46, 48, 58, 59, 61, 62, 65, 67, 68, 69, 72, 77, 78, 86</td> </tr> </tbody> </table>	Type	No. of HHs	Remarks	Shade tree	15	Albizia, Indian almond, Neem tree, etc. HH No. 20, 40, 43, 48, 51, 57, 59, 61, 62, 67, 69, 72, 73, 77, 85	Fruit tree	37	Banana, Mango, sugar cane, coconut, citrus and jack fruit etc. HH No. 3, 15, 17, 20,21, 23, 28, 30, 31, 32, 34, 37, 40, 41, 48, 51, 52, 55, 57, 58, 59, 61, 62, 63, 67, 68, 70, 71, 72, 73, 77, 78, 82, 85, 86, 88	Vegetables	20	Chili, tomato, bitter gourd, Roselle, gourd, basils, eggplant etc. HH No. 12, 17, 21, 41, 49, 58, 59, 61, 62, 63, 67, 68, 70, 71, 72, 73, 77, 82, 85, 86	Flowering plant	31	Jasmine, poinsettia, orchid, kiss me quick, etc. HH No. 3, 5, 6, 8, 10, 12, 13, 14, 17, 20, 21, 22, 23, 29, 30, 31, 32, 46, 48, 58, 59, 61, 62, 65, 67, 68, 69, 72, 77, 78, 86
Type	No. of HHs	Remarks														
Shade tree	15	Albizia, Indian almond, Neem tree, etc. HH No. 20, 40, 43, 48, 51, 57, 59, 61, 62, 67, 69, 72, 73, 77, 85														
Fruit tree	37	Banana, Mango, sugar cane, coconut, citrus and jack fruit etc. HH No. 3, 15, 17, 20,21, 23, 28, 30, 31, 32, 34, 37, 40, 41, 48, 51, 52, 55, 57, 58, 59, 61, 62, 63, 67, 68, 70, 71, 72, 73, 77, 78, 82, 85, 86, 88														
Vegetables	20	Chili, tomato, bitter gourd, Roselle, gourd, basils, eggplant etc. HH No. 12, 17, 21, 41, 49, 58, 59, 61, 62, 63, 67, 68, 70, 71, 72, 73, 77, 82, 85, 86														
Flowering plant	31	Jasmine, poinsettia, orchid, kiss me quick, etc. HH No. 3, 5, 6, 8, 10, 12, 13, 14, 17, 20, 21, 22, 23, 29, 30, 31, 32, 46, 48, 58, 59, 61, 62, 65, 67, 68, 69, 72, 77, 78, 86														
	<p><b>Photos,</b></p> <div style="display: flex; flex-wrap: wrap;">     </div>															
<p>(3) Livestock</p>	<p><u>Description</u></p> <p>-The chicken and geoses are being raised.</p> <table border="1" data-bbox="571 1794 1193 1928"> <thead> <tr> <th>Type</th> <th>No. of HHs</th> <th>Remarks</th> </tr> </thead> <tbody> <tr> <td>Chicken</td> <td>6</td> <td>HH No. 13, 14, 21, 59, 67, 78</td> </tr> <tr> <td>Goose</td> <td>2</td> <td>HH No. 40, 67</td> </tr> </tbody> </table>	Type	No. of HHs	Remarks	Chicken	6	HH No. 13, 14, 21, 59, 67, 78	Goose	2	HH No. 40, 67						
Type	No. of HHs	Remarks														
Chicken	6	HH No. 13, 14, 21, 59, 67, 78														
Goose	2	HH No. 40, 67														



**Photos**

