
Bi weekly Field Report

SurveyorZaw LaDate visited22 Apr 2020Time visited15:30 am

Weather Condition <u>Sunny</u> The last time of heavy raining:

No	Item	Condition	Narrative Description and Photos			
1	(1.1) Water Supply System	Improved □ Same ■* Worse □ *as last week	Narrative Description Water distribution system has been supporting ninety household of the zone B resettled families. The new well was drilled and installed the pipe line and its necessary instruments because the underground water of the previous well includes iron hydroxide and yellowish mud that clogged in the iron removal tank. The current water condition is quite good and no iron hydroxide and yellowish mud are found. Photos			
			Water from ground water tank	Pipe line distribution water to houses		

No	Item	Condition	Narrative Description and Photos
1	(1.2) Well	Improved□ Same ■* Worse □ *as last week	Water from two open-wells is clean enough to use for drinking and living. There are eleven tube wells in the relocation site. Residents use the water basically from the pipeline distribution system so that the frequency of water usage from the tube wells is very low. To sustain the good condition of the tube wells, the leg pumps were kept and covered the PVC pipes with the caps till the residents use.
			Open Well No. 1
	(2) Drainage	Improved□ Same ■ * Worse □ * <i>as last week</i>	 There is no water in the drainage canals at the moment. Photos The drain at the corner of Main Road A and B The drain at the corner of Main 2nd street The exit of the drain at the corner of Site village road and 2nd street
	(3) Road	Improved□ Same © * Worse □	 All the roads are dry and no problem for walking. Photos

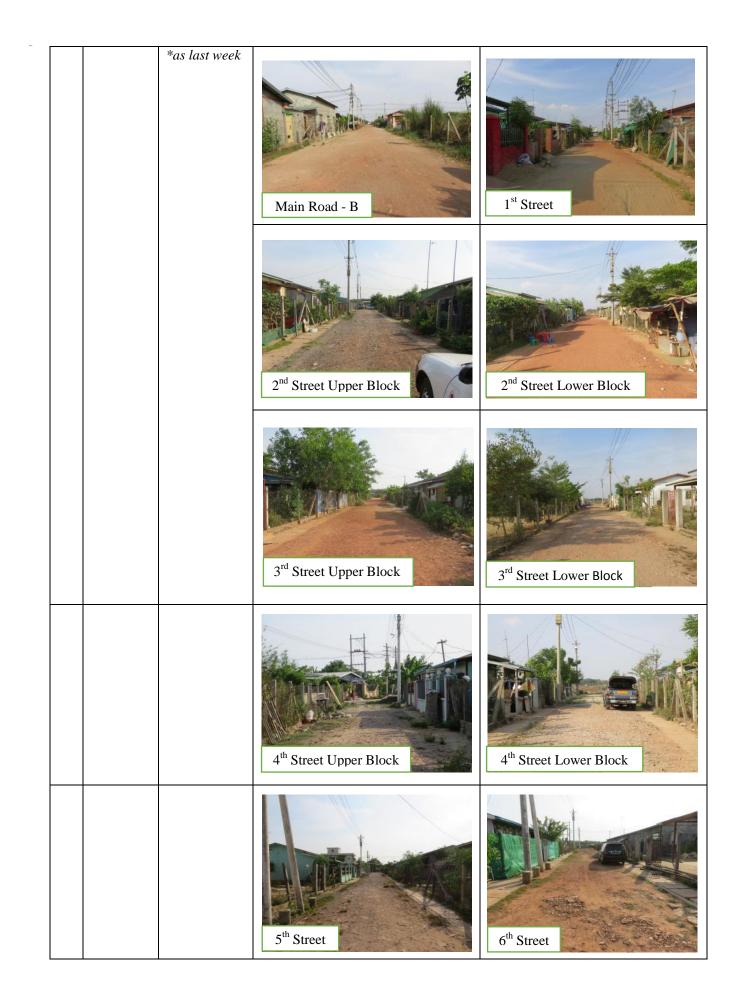

		T th Street	Site Village Road
(4) Garbage Condition	Improved□ Same @ * Worse □ * <i>as last week</i>	of each road until the end of April are kept by the community leader of well number one of main road	e bins are provided. been provided and placed at the corner l. After April 2018, all the garbage bins of PAPs in the communal compound B. But starting from October, the nicipal office came and collected by
		Rubbishes in the creek near 1st street	Rubbishes in the creek near 2nd street
		The soil was filled near the creek of Main Road C in March	The soil was filled near the creek of 6 th Street in March

Γ	(5) Fly	Improved□	– All of the	e fly proof toilets are use	d by the residents	
	proof	Same ■ *		e toilets are repaired by the	-	·es·
	toilet	Worse \square		istallation the extra septio		
		*as last week		he pipe line system is ins		
				o flow the liquid out.		tank to the utten
				ovation plan was successf	fully done and there is	no problem at
			the moment.	fullon plan was successi	ung done und diere is	no procient u
				No. of I	HHs	
			Condition	This week condition	Previous	
					week condition	
			Level 1	91	91	
			Level 2	0	0	
			Level 3	0	0	
			Level 4	0	0	
			No Toilet	0	0	
			<evaluation< td=""><td>Criteria></td><td></td><td></td></evaluation<>	C riteria>		
			Level 1			
				let is not needed to be rep	paired.	
				let unavailable		
			Level 2			
				let is needed to be repaire	ed.	
			- Rarely toilet	unavailable		
			Level 3	let is needed to be repaire	d	
			- Often toilet u		<i>c</i> u.	
				of filling the soil and als	o due to the heavy rai	n some
				onvenience to use.	o due to the newly ful	ii, some
			Level 4			
				let is urgently needed to l	be repaired.	
			- Often toilet u			
			Photos			
						All a
			And And		E. E	TE MAN
			C. Press			
			THE STREET			
						A MAR AND
			House No.	46	House No. 50	and the second
					1220	
				A ARE H		
			anne special		Same and	
			the Barrier			
			House Mr.	20	House No. 97	
			House No.	00	House No. 87	THE STREET

	(6) Electricity	Improved□ Same © * Worse □ *as last week	 Residents get the electricity regula Electric poles and transformer are foundations. There are some pieces of wood ur and it's needed to clean up. Photos 	
			Transformer No. 1	Transformer No. 2
			Transformer No. 3	Electric poles of Main Road B and Main Road C
No	Item	Condition	Description	and Photos
No 2	Item (1)House Construct- ion	Condition No. of houses which are not completed (4)	 In plot No.9 and 10, three houses are owned by father and son. The are needed to be carried on. 	that are planned to build as the plots e second floors of these three houses on for the first floor has been finished
	(1)House Construct-	No. of houses which are not	 In plot No.9 and 10, three houses are owned by father and son. The are needed to be carried on. Plot No. 66, the house construction 	that are planned to build as the plots e second floors of these three houses on for the first floor has been finished
	(1)House Construct-	No. of houses which are not	 In plot No.9 and 10, three houses are owned by father and son. The are needed to be carried on. Plot No. 66, the house construction and the second floor is still needed 	that are planned to build as the plots e second floors of these three houses on for the first floor has been finished

3	Other Issues				
	(1). Drainage condition for	Description			
	rain water in the compounds				
		Condition	No. of HHs This week	Previous we	nalt.
		Condition	condition	condition	ek.
		Level 1	89	89	
		Level 2	2	2	
		Level 3			
		Level 4			
		compound <i>Level 2</i>	o standing wate	er with their own	n drainage system in their
		Level 3	o standing wate	in their compo	Juna
		- Some or little	mud and stand	ing water in the	ir compound
		Level 4			
		-A lot of mud a	and standing wa	ter in their com	pound
		<u>Photos</u>			
		Level 1 House No. 3			vel 2 Duse No. 19
		Level 3 House No. 6	4		vel 4 use No. 84
		Level 3 House No. 7	75		vel 4 Deserved to the second s

(2) Plantation	- In front of the compounds, the shady trees, fruit trees, flowering plants and vegetables are being planted.					
	Description					
	-	1		es, fruit trees, flowering plants		
	Type No. of Remarks HHs Itematical Itematical			Remarks		
	Shade tree	15		almond, Neem tree, etc. 43, 48, 51, 57, 59, 61, 62, 67, 5		
	Fruit tree	37	and jack fruit etc HH No. 3, 15, 17 37, 40, 41, 48, 5	7, 20,21, 23, 28, 30, 31, 32, 34 1, 52, 55, 57, 58, 59, 61, 62,		
	Vegetables	20	Chili, tomato, bi basils, eggplant o HH No. 12, 17, 2	21, 41, 49, 58, 59, 61, 62, 63,		
	Flowering plant	31	Jasmine, poinset HH No. 3, 5, 6, 8	2, 73, 77, 82, 85, 86 tia, orchid, kiss me quick, etc. 3, 10, 12, 13, 14, 17, 20, 21, 1, 32, 46, 48, 58, 59, 61, 62, 2, 77, 78, 86		
	Photos,		05, 07, 00, 09, 72	2, 77, 70, 00		
(3) Livestock	Description					
	-The chicken an Type	d gooses an No. of H				
	Chicken	6	HH No. 13,	14, 21,		
	Goose		59, 67, 78 HH No. 40,	67		
	Goose	2	ΠΠ NO. 40.	0/		

